

IDM UID

version created on / version / status 27 Mar 2023 / 1.5 / Approved

EXTERNAL REFERENCE / VERSION

Technical Specifications (In-Cash Procurement)

Manufacturing of Quartz Optical components for ITER diagnostic windows

Open Tender for:

The purpose of this document is to provide the technical specifications for the:Procurement of Quartz Disks and beams for the qualification and final manufacturing of Diagnostics' Quartz WindowsValidation of mechanical properties QuartzMeasurement of Flexural strength Characterization of Sub critical crack growth Measurement of fracture toughness

Table of Contents

1	PU	URPOSE	3
2	SC	COPE	3
3	D	EFINITIONS	4
4	R	EFERENCES	4
5	ES	STIMATED DURATION	5
6	C	ODES AND STANDARDS	5
7 M	Q ANU	UARTZ DISKS AND BEAMS FOR QUALIFICATION AND JFACTURING OF WINDOWS	6
8	R	EQUIREMENTS ON SYNTHETIC CRYSTALLINE QUARTZ MATERIAL	7
	8.1	Radiation hardness	8
	8.2	Composition / Impurities	8
	8.3	Optical Transmission	8
	8.4	Optical Index	9
	8.5	Quality Grade	9
	8.6	Crystallographic orientation	9
	8.7	Dielectric properties	.10
	8.8	Thermal properties	
	8.9	Mechanical Properties	.10
9	R	EQUIREMENTS ON FINISHED POLISHED PRODUCTS	.11
10) TI	ESTING	.11
	10.1	Mechanical Testing	.11
	10	0.1.1 Fracture toughness	.11
	10	0.1.2 Slow crack growth exponent	.11
	10	0.1.3 Mechanical strength	.12
	10	0.1.4 Acceptance criteria for tests	.12
	10.2	Chemical Analysis	.12
	10.3	Optical Testing	.12
11	M	ANUFACTURING PROGRAMME	.13
12	D	OCUMENTATION AND TEST REPORTS	.13
	12.1	Material acceptance	.13
	12.2	Material test reports	.13
	12.3	Disc acceptance	.14
	12.4	Dimensional check - tolerances	.14

13	IDI	ENTIFICATION AND MARKING	15
14	CL	LEANLINESS	15
15	PA	CKAGING / MARKING	15
16	SA	FETY REQUIREMENTS	15
17	QU	JALITY ASSURANCE REQUIREMENTS	15
1	7.1	Access of Inspectors	16
1	7.2	Manufacture and inspection plan	16
18	DE	EVELOPMENT MILESTONES AND DELIVERIES	17
19	PU	RCHASE ORDER FOR PRE-FORM MATERIAL	17
20	RE	ESPONSIBILITIES	17
2	0.1	Contractor's Responsibilities	17
2	0.2	IO's Responsibilities	17
21	LIS	ST OF DELIVERABLES AND DUE DATES	17
22	AC	CCEPTANCE CRITERIA	18
23	WC	ORK MONITORING / MEETING SCHEDULE	18
24	DE	LIVERY TIME BREAKDOWN	18
25	QU	JALITY ASSURANCE (QA) REQUIREMENTS	18
2	5.1	Access of inspectors	19
2	5.2	Testing Plan	19
26	CA	AD DESIGN REQUIREMENTS (IF APPLICABLE)	20
27	SA	FETY REQUIREMENTS	20

1 Purpose

The purpose of this document is to provide the technical specifications for the:

- Procurement of Quartz Disks and beams for the qualification and final manufacturing of Diagnostics' Quartz Windows
- Validation of mechanical properties Quartz
 - Measurement of Flexural strength
 - Characterization of Sub critical crack growth
 - Measurement of fracture toughness

For information, each window assemblies is composed by:

- A structural body provided with a bolted flange, for the mechanical and vacuum tight attachment on a vacuum extension also called "mating flange".
- Two transparent discs assembled into metallic ferrules by aluminium diffusion bonding.
- An interspace volume between both discs, whose pressure is permanently monitored by the Service Vacuum System (SVS).

An example can be seen in Figure 1.

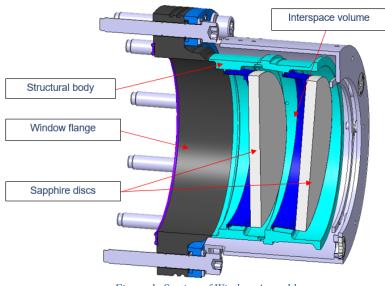


Figure 1: Section of Window Assembly

The design of the bolted flanges is similar to the one of the ITER standard vacuum flange. The size of the bolted flange is tailored to the clear aperture.

2 Scope

This specification covers the procurement of Quartz (disks and beams) for the diagnostic windows assemblies. It addresses the following items.

- Technical specifications of the raw material, including the definition of additional samples required for material characterization,
- Technical specifications of the polished discs,
- Amount and types of discs to be procured.
- Mechanical testing specifications to be performed in order to guarantee

The coating of samples is outside of this contract and therefore is listed in this technical specification only for traceability reasons.

3 Definitions

AoI:	Angle of Incidence
AR:	Anti reflection
CV:	Clear View
DA:	Domestic Agency
FWHM:	Full with at half maximum
HP:	Hold Point
IO:	ITER Organization
IO-TRO:	ITER Organization technical Responsible Officer.
PPS:	Pro
DT	
RT:	Room Temperature
RT: SIC	Room Temperature Safety Important Component
	-
SIC	Safety Important Component
SIC SSD:	Safety Important Component See System Design

For a complete list of ITER abbreviations see: ITER Abbreviations (ITER_D_2MU6W5).

4 References

Ref	Title	IDM link
[R1]	ITER Procurement Quality Requirements	ITER_D_22MFG4
[R2]	Requirements for Producing a Quality Plan	ITER_D_22MFMW
[R3]	ITER Policy on Safety, Security and Environment Protection Management.	ITER_D_43UJN7
[R4]	Order dated 7 February 2012 relating to the general technical regulations applicable to INB - EN	ITER_D_7M2YKF
[R5]	System Design Description (DDD) 55.NW Windows	ITER_D_46NXUU
[R6]	Cat2-#28-Outgassing-requirement-resolution-memo	ITER_D_2S6JQM
[R7]	Appendix C21 Product Procurement Specifications Quartz Disc	ITER_D_3QQKJR
[R8]	ITER Vacuum Handbook	ITER_D_2EZ9UM
[R9]	IS 55.NW-55	UDS88X
[R10]	Sub-System Requirement Document sSRD-55.NW: Windows	ITER_D_WYWVMP
[R11]	55.NW System Loads Specifications for Quartz Windows	ITER_D_XLC4VW
[R12]	Existing Practices For Diagnostic Window Assembly	ITER_D_2WBW2V
[R13]	WA manufacturing management specification	ITER_D_YHXUXZ

[R14]	WA manufacturing technical specification	ITER_D_YHYAJK
[R15]	ITER_D_SBSTBM - Provisions for Implementation of the Generic Safety Requirements by the External Actors/Interveners	ITER_D_SBSTBM
[R16]	Propagation of the Defined Requirements for Protection Important Components Through the Chain of External Interveners	ITER_D_BG2GYB
[R17]	Development and manufacturing of AR coating for Diagnostic Windows	ITER_D_8G6ULU

5 Estimated Duration

The duration shall be for 36 months. No work shall commence prior to the date of final signature of the Contract.

6 Codes and Standards

[RQ-001] The following Standards shall be referred to in this specification:

- IEC 60758:2016-05 Synthetic Crystal Quartz Specifications and guidelines for use.
- ISO 10110-2 Optics and optical instruments Preparation of drawings for optical elements and systems Part 2: Material imperfections Stress birefringence
- ISO 10110-3 Optics and optical instruments Preparation of drawings for optical elements and systems Part 3: Material imperfections Bubbles and inclusions
- ISO 10110-4 Optics and optical instruments -- Preparation of drawings for optical elements and systems -- Part 4: Material imperfections -- Inhomogeneity and striae
- ISO 12123 Optics and photonics Specification of raw optical glass
- ASTM C1499 Standard Test Method for Monotonic Equibiaxial Flexural Strength of Advanced Ceramics at Ambient Temperature
- ASTM C1322 Standard Practice for Fractography and Characterization of Fracture Origins in Advanced Ceramics
- EN 14425-3 Advanced technical ceramics. Test methods for determination of fracture toughness of monolithic ceramics. Chevron notched beam (CNB) method
- EN 843-3 Advanced technical ceramics. Mechanical properties of monolithic ceramics at room temperature. Determination of subcritical crack growth parameters from constant stressing rate flexural strength tests
- ASTM C1368 Standard Test Method for Determination of Slow Crack Growth Parameters of Advanced Ceramics by Constant Stress-Rate Strength Testing at Ambient Temperature
- ASTM C1465 Standard Test Method for Determination of Slow Crack Growth Parameters of Advanced Ceramics by Constant Stress-Rate Flexural Testing at Elevated Temperatures
- EN 821-1 Advanced technical ceramics. Monolithic ceramics. Thermo-physical properties. Determination of thermal expansion
- ISO 21254-1:2011 Lasers and laser-related equipment Test methods for laser-induced damage threshold

- [RQ-002] All materials and testing standards mentioned in this document shall be considered in their last revision at the time of the sign of the contract.
- [RQ-003] Other equivalent national or international standards and codes may be acceptable with prior written IO approval, provided all criteria are satisfied.

7 Quartz disks and beams for qualification and manufacturing of windows

In total, to accommodate the requirements of the several diagnostic systems five disc variations are required. They differ in clear view (CV) size, thickness, wedge and coating requirements.

- [RQ-004] For final window manufacturing purpose, the contractor shall supply the IO with the specimens listed in Table 1.
- [RQ-005] The manufacturing of Batch#2 in Table 1 shall not start before clearing a hold point (HP) for the successful qualification of the Quartz window assembly which IO will carry out with the specimens defined in Table 2. Note that the window assembly qualification is not the scope of this contract. The qualification failure may cause the design change of the Quartz disk.

Mark	Main geometry features	Coating system*	Quantity Batch#1	Quantity Batch#2
N°1	Disc \emptyset 82 mm CV T = 10.8 mm	No coating	0	30
N°2	Disc Ø 82 mm CV T = 10.8 mm	CS#01-Q	7	0
N°3	Disc Ø 130 mm CV T = 13.4 mm – Wedge 2°	No coating	0	8
N°4	Disc Ø 82 mm CV T = 9.8 mm	CS#02-Q	0	8
N°5	Disc \emptyset 82 mm CV T = 10.5 mm	CS#02-Q	0	8

Table 1: Specimens to be supplied for the qualification of the window assemblies

*Note: the definition of the coating system is given in [R17].

[RQ-006] For window assembly qualification purpose, the contractor shall supply the IO with the specimens listed in Table 2

Table 2: Specimens to be supplied for the qualification of the window assemblies

Mark	Main geometry features	Coating system	Quantity
N°21	Disc Ø 30 mm CV T = 4 mm	No coating	5
N°22	Disc \emptyset 82 mm CV T = 9.8 mm	No coating	5
N°23	Disc Ø 130 mm CV T = 13.4 mm – Wedge 2°	No coating	2

[RQ-007] For material characterisation purpose, the contractor shall in addition manufacture the specimens listed in Table 3.

Mark	Main geometry features	Reference test	Coating system	Quantity
N°31	Beam 45 x 4 x 3 mm	Fracture toughness	No coating	10
N°32	Beam 25 x 2.5 x 2 mm	Slow crack growth	No coating	50
N°33	Beam 25 x 2.5 x 2 mm	Slow crack growth	CS#1-Q	50
N°34	Beam 25 x 2.5 x 2 mm	Slow crack growth	CS#2-Q	50
N°35	Beam 25 x 2.5 x 2 mm	Mechanical Strength	No coating	10

Table 3 · Specimens	required for material	characterization
rubic 5. Specimens	reguirea jor maieriai	churacter ization

[RQ-008] For optical tests (transmission ratio) after irradiation, the contractor shall manufacture the cylindrical specimens specified in the Table 4. Irradiation and coating operations are not under the scope of this contract

Mark	Main geometry features	Coating system	Bubbles & Inclusions	Quantity
N°41	Cylinder Ø20 mm	No coating	1/ 1x0.08	5
	x 10 mm			
N°42	Cylinder Ø20 mm	CS#1-Q	1/ 1x0.08	5
	x 10 mm			
N°43	Cylinder Ø20 mm	CS#2-Q	1/ 1x0.08	5
	x 10 mm			

Table 4: cylindrical specimens for optical testing

[RQ-009] For validation of the Anti-Reflective coating the contractor shall in addition manufacture the specimens listed in Table 5.

Mark	Main geometry features	Coating system	Quantity
N°51	Disc Ø 82 mm CV	CS#1-Q	5
IN 51	T = 9.8 mm	C5#1-Q	5
	Disc Ø 82 mm CV		
N°52	T = 9.8 mm	CS#2-Q	5

Table 5: Disks for qualification of Anti-reflection coating system

8 Requirements on Synthetic Crystalline Quartz Material

This section defines the technical requirements as regards the material properties of synthetic crystalline quartz $(Si0_2)$ high quality grade. They are related to the procurement of the blank material, i.e. regardless of the final forming and polishing of the disks.

[RQ-010] According to the importance of the material property, with respect to the function of the disks on the ITER machine, the characterization of the property shall be achieved in different ways.

Typical value / Existing measurements: The material characteristic is an intrinsic property linked to the chemical composition of the material and the production process. The current technical specification presents the typical expected values. A value of the property shall be provided by the supplier of the material, based on existing measurements achieved on samples of the same material grade and brand. In case the material property characteristic has not been measured, measurements performed on the first production batch could be carried out.

Specific measurements: The material property is a key characteristic of the material, which shall be measured at least once, on one production batch, when the manufacture and inspection plan has been approved by the IO.

<u>Systematic measurements</u>: A systematic measurement of the property shall be carried out, either on the pre-form material or on the final product, to control the quality of the production.

8.1 Radiation hardness

Located around the Tokamak the window assemblies are subjected to neutron and gamma irradiation. Irradiation fluences and doses given below are those expected for the most exposed window assemblies.

- Total neutrons fluence (> 1 MeV) in ITER lifetime $: 1.0 \times 10^{17} \text{ n/cm2}$, within 20 years,
- Gamma dose : 10 MGy
 Dose rate : 330 Gy/h,

This Technical Specification includes the supply of dedicated samples intended for radiation exposure and subsequent testing.

8.2 Composition / Impurities

- [RQ-011] The material shall be high-quality Synthetic Crystalline Quartz, got from crystal growth ensuring low thermal stress-induced defects within the bulk material as well as low level of impurities.
- [RQ-012] A chemical analysis of the blank material shall be carried out according to the requirements defined in §10.2 This shall be a systematic measurement carried out on each production lot.

8.3 Optical Transmission

[RQ-013] Synthetic Crystalline Quartz shall meet the transmission performances specified in Table 6. The transmission ratio includes the attenuation in the bulk material and the reflection losses due to the refractive index on both sides. It does not include anti-reflection coating. This can be justified by using existing measurements.

Wavelength (μm)	Minimal transmission %
0.3	90 %
0.380	90 %
0.78	90 %
299 (1THz)	66 %
599 (500 GHz)	66 %
1816 (165 GHz)	90 %
10 000 (30 GHz)	90 %

Table 6: Transmission requirements – Thickness = 10 mm

These requirements are given for the as-built material. I.e. it does not take into account further attenuation induced by the nuclear environment.

8.4 Optical Index

 $[RQ-014] \qquad \mbox{The contractor shall provide the IO with the optical indexes of Crystalline Quartz material within the wavelength range [0.3 \ \mu m - 0.78 \ \mu m] and at 119 \ \mu m. This can be based on existing measurements.}$

8.5 Quality Grade

[RQ-015] The synthetic crystalline quartz grade shall conform to the quality requirements listed in the table below, and reminded in the detailed drawings.

Criteria	Quality requirement	Standard
Inclusions density	Grade I a $10-30 \ \mu m \le 2 \ / \ cm3$ $30-70 \ \mu m \le 1 \ / \ cm3$ $> 70 \ \mu m$ not allowed.	IEC 60758:2016 (§4.1.3.1 / Table 1.)
Infrared Quality Indications	Grade OPT A	IEC 60758:2016 (§4.1.6 / Table 4.)
Etch channel density	Grade 1aa - $< 2 \text{ cm}^{-2}$	IEC 60758:2016 (§4.1.8.1 / Table 5)
Striae	Not allowed	IEC 60758:2016 (§4.2.8)
Stress birefringence	< 5 nm/cm (0/5)	ISO 10110-2
Inhomogeneity	$\Delta n < 3.10^{-6}$	ISO 10110-4
Metallic impurities	Total metallic impurities < 5 ppm	

[RQ-016] These requirements shall be demonstrated by measurements on samples drawn from the first production batch.

8.6 Crystallographic orientation

[RQ-017] In order to benefit from uniform optical quality and constant mechanical strength for all Synthetic Crystalline Quartz discs, Z-axis cut crystal Quartz discs are required. Cutting angle accuracy are specified in the manufacture drawing of each disc (Mark#1 to Mark#5) in ANNEX I.

8.7 Dielectric properties

[RQ-018] The dielectric properties of crystalline quartz material shall be provided by the contractor, based on specific measurements of the relative permittivity and loss tangent δ , at 60 GHz, at 145 GHz and at 170 GHz.

[RQ-019] The dielectric properties at 145 GHz shall be:

- Permittivity $: 4.4 \pm 0.1,$
- Loss tangent $: < 4 \ge 10^{-5}$.

8.8 Thermal properties

- [RQ-020] The thermal expansion coefficients of the crystalline quartz material (parallel and perpendicular with the Z axis) in the range 20°C 200°C shall be provided by the contractor based on its own measurements. This can be based on existing measurements.
- [RQ-021] The thermal conductivity of crystalline quartz material (parallel and perpendicular with the Z axis) in the range $20^{\circ}C 200^{\circ}C$ shall be provided by the contractor, based on its own measurements. This can be based on existing measurements.
- [RQ-022] The specific heat of crystalline quartz material in the range 20°C 200°C shall be provided by the contractor, based on its own measurements. This can be based on existing measurements.

8.9 Mechanical Properties

[RQ-023] The mechanical properties of synthetic crystalline quartz material shall conform to the requirements listed in Table 7. During the test the tensile surface of the specimen shall correspond to the Z-plane.

Requirements on mechanical properties				
Tensile strength (perpendicular direction)	> 50 MPa	EN 843-1:2006		
Fracture toughness - K _{IC} (perpendicular direction)	$\geq 0.7 \text{ MPa.m}^{1/2}$	EN 14425-3		

		1.		
Table 7 : Technica	l requirements	regarding	material	properties

[RQ-024] The mechanical properties linked to the crack propagations within the bulk material shall be determined by physical measurements, unless they can be provided from the material supplier. These parameters are

- The crack growth parameter A,
- The crack growth exponent n.

[RQ-025] The mechanical properties shall be measured on samples drawn from the first production batch, according to the specifications defined in §10.1.

9 Requirements on finished polished products

- [RQ-026] The quality of the optical polishing shall be checked by systematic measurements on every finished products, before coating. The surface imperfection tolerances according to ISO 10110-7 shall be checked after coating as well.
- [RQ-027] The requirements on optical quality are defined in the detailed drawings of the discs given in ANNEX I according to the ISO 10110.
- [RQ-028] Although the edges of the disc are not functional from the optical point of view, they shall be polished according to the requirements defined in the detailed drawings, to avoid the presence of cracks, which might the root of crack propagation. This applies to the chamfers as well.

10 Testing

10.1 Mechanical Testing

The objective of the characterization is to get the key properties of the material from a structural perspective. The properties to be identified are:

- Fracture toughness
- Slow crack growth parameter A and exponent n
- Mechanical strength

The samples to be tested shall be manufactured and polished (P3 ; < 2 m_{rms}) according to the specifications of the final products (§ ANNEX I).ones.

10.1.1 Fracture toughness

[RQ-029] The samples to be tested are beams of $45 \times 4 \times 3 \text{ mm}^3$

[RQ-030] Test according to EN-14425-3:2010

[RQ-031] The number of samples tested and temperatures at which the test are to be carried out are detailed in Table 8

Table 8:	List to	ests for	Fracture	toughness
----------	---------	----------	----------	-----------

Test Reference	Mark	Quantity samples	Testing Temperature
FT #1	N°31	10	RT

10.1.2 Slow crack growth exponent

- [RQ-032] The samples to be tested are beams of $25 \times 2.5 \times 2 \text{ mm}^3$
- [RQ-033] Test according to EN-843-3:2005

[RQ-034] The number of uncoated samples tested and temperatures at which the test are to be carried out are detailed in Table 9.

Test Reference	Mark	Quantity samples	Testing Temperature
SCCG #1	N°32	50	RT
SCCG #2	N°33	50	RT
SCCG #3	N°34	50	RT

Table 9: List of tests for uncoated slow crack growth exponent

10.1.3 Mechanical strength

[RQ-035] The samples to be tested are beams of $25 \times 2.5 \times 2 \text{ mm}^3$

[RQ-036] Test according to EN-843-1:2006

[RQ-037] The number of samples tested and temperatures at which the test are to be carried out are detailed in Table 10

Test Reference	Mark	Quantity samples	Testing Temperature
MS #1	N°35	10	RT

10.1.4 Acceptance criteria for tests

The acceptance criteria for each test is:

	[RQ-038]	Fracture toughness	FT> 0.7 MPa.m ^{1/2}
--	----------	--------------------	------------------------------

[RQ-039] Sub critical crack growth exponent on coated and uncoated samples n>23

[RQ-040] Flexural strength MS>50Mpa (Hold point to assess material characteristics)

10.2 Chemical Analysis

- [RQ-041] The chemical composition of the blank material shall be carried out on samples extracted from the as-grown synthetic quartz crystal.
- [RQ-042] The Manufacturer shall supply a chemical composition analysis certified by the Manufacture accredited representative. Chemical analyses and crosschecks shall be performed in a laboratory of the Manufacturer's choice according to the laboratory usual methods. In the event of disagreement, the chemical analyses shall be performed in accordance with standards and in the laboratory selected and/or agreed by all parties. Calibration methods and results of verifications performed on testing equipment shall be available for consultation in the laboratory.

10.3 Optical Testing

[RQ-043] They shall be verified by systematic measurements carried out on every polished disc, before or after coating as specified in the Table 11.

Table 11.	· Manufacture	step of the	quality control
-----------	---------------	-------------	-----------------

Requirement	On lumbered synthetic	Before coating	After
	quartz crystal		coating*

0 / Birefringence	Х	Х	
1 / Bubbles and Inclusions	Х		
2 / Heterogeneity and striae	Х		
3 / Surface form tolerance		Х	
5 / Surface texture		Х	Х

* Outside scope of this contract

11 Manufacturing Programme

- [RQ-044] The transparent element blank material shall be clearly specified before being manufactured.
- [RQ-045] Before manufacturing process starts, the Manufacturer shall draw up a manufacturing programme and a qualification test plan. The various processes, treatments, sampling and examinations shall be presented in chronological order.
- [RQ-046] During the production work, various parameters on the material design must be controlled to ensure that the tested data remains valid for the disks production. This shall include the composition and growth process parameters (temperature, time, and environment).
- [RQ-047] The forming process from the rough to the finish cutting shall consider the most suitable way to limit residual stresses and cracks into the material. The grit sizes of the grinding tools shall be relevant throughout the forming process. Acceptance criteria based on blank material dimensions shall be defined by the manufacturer during the qualification process, to guarantee the reproducibility of the final manufacturing process.
- [RQ-048] A qualification test plan for the materials procurement shall be approved by the ITER organization before the beginning of the procurement.
- [RQ-049] The number of tests to be performed for each production batch shall be specified in the qualification test plan.

12 Documentation and test reports

[RQ-050] All documents shall be in the English language and all measures shall be given in the metric system SI. Each document shall be provided as an electronic file in PDF format.

12.1 Material acceptance

- [RQ-051] Material inspection certificate (Type 3.1 EN 10204) and material tests report have to be provided by the Manufacturer before starting the manufacture of the final products (polished and coated discs specified in Table 1 and Table 2).
- [RQ-052] To be accepted, the material shall be proven to conform to the requirements of the present document.

12.2 Material test reports

- [RQ-053] Material test report shall provide the results of all measurements (existing, specific or systematic) performed on both material grades. It shall include the following results:
 - Chemical composition,
 - Optical transmission,
 - Optical index,
 - Optical quality (according to § 8.5)
 - Dielectric properties,
 - Thermal expansion coefficient, (if a test is required to ascertain the property),
 - Thermal conductivity, (if a test is required to ascertain the property),
 - Specific heat, (if a test is required to ascertain the property),
 - Flexural strength,
 - Fracture toughness,
 - Slow crack growth exponent.

[RQ-054] A particular attention shall be paid to the traceability of the measurements. For that purpose, these reports shall include:

- Blank material identification
- Manufacturer identification
- Purchase order number
- Name of the inspection agency, where applicable
- Test method and measurement sensitivity
- Test and retest results together with required values
- Localisation and identification of extracted samples with respect to geometry of the preform (dimension; length; thickness); sample number

12.3 Disc acceptance

[RQ-055] The acceptance of the final products (finished and coated discs) is based on

- Material conformity certificate,
- Inspection report.

[RQ-056] The inspection report shall collect the following pieces of information.

- Dimensional measurement report,
- Measurements of the optical quality Wave front error, Surface imperfection tolerances and Surface texture.
- Results of inspection and measurements specified in the present document.

[RQ-057] The supplier factory acceptance procedure shall be submitted to the ITER Organization for acceptance. The acceptance procedure shall at least include:

- Measurement of the optical characteristics over the relevant wavelength range,
- Surface imperfection tolerances measurement in accordance with ISO 10110-7. It shall be carried out for all windows and spread on the whole coated surfaces.

- Adhesion Testing, Abrasion Testing, Cleaning Ability Testing on witnesses for all coating batch.
- Review of the control and inspection reports.

12.4 Dimensional check - tolerances

[RQ-058] The dimensions shall be checked in accordance with the requirements of procurement drawings. The main dimensions shall be recorded. The values shall be within the tolerances given on the procurement drawing.

13 Identification and Marking

- [RQ-059] By agreement between IO, the blank material manufacturer and the window manufacturer, an agreed methodology for traceably identifying individual window blanks throughout their processing into finished windows shall be defined.
- [RQ-060] Any method of physically marking the window shall not introduce damage or stress which might subsequently affect the mechanical performance.
- [RQ-061] Only painted or inked marking is permitted. They shall be neither indelibly marked, nor engraved, nor laser inscribed. Allowed inks and paints shall be specified to ensure material compatibility.

14 Cleanliness

[RQ-062] <u>Appendix_N_Cleanliness_surface_finish_vacuum_requirements</u> requirements shall apply.

15 Packaging / marking

[RQ-063] Each disc shall be packed individually

- First packing in a lens paper (after cleaning)
- Second packing in a plastic bag with the identification reported in the control report
- A third packing in a hermetically sealed plastic bag
- And a fourth packing in a rigid box (each component or sample is packed in a rigid box). The marking shall be identified on the rigid box.

16 Safety requirements

The diagnostic window assemblies are classified Protection Important Components Class 1.

[RQ-064] The Manufacturer shall comply with the requirements defined in of <u>ITER D_YHXUXZ-WA manufacturing management specification</u> [R13] and <u>ITER D_YHYAJK- WA manufacturing technical specification</u> [R14], making sure that the safety requirements are properly propagated to any sub-contractors involved in the manufacture activities of the discs, according to [R15] and [R16].

17 Quality Assurance requirements

- [RQ-065] The Manufacturer shall comply with all requirements of ISO 9001 Certification. A quality assurance organization shall be implemented as required for fabrication in nuclear and ultra-high vacuum systems.
- [RQ-066] All procedures and specifications related to the materials procurement, qualification testing and acceptance testing shall be accepted by ITER before starting the manufacturing process.

[RQ-067] Particular attention shall to be paid to the traceability of all materials:

- Material origin; date of manufacturing
- Material manufacturing process identification
- Batch number of the pre-form
- Tests and inspections records
- Samples extracted from the blank shall be identified and kept after the tests
- Dates of inspections, instrumentation used for inspections, date of last calibration

[RQ-068] All data, which can have an impact on the reproducibility of the properties, shall be recorded and kept.

17.1 Access of Inspectors

- [RQ-069] Representatives of the IO and of Third Party Inspectors (TPI) shall at reasonable notice have right to check at the Manufacturer premises the progress and status of the task and to witness the specified tests.
- [RQ-070] The Manufacturer shall hold and make available to the IO and TPI all necessary information and documentation to determine the progress and status of the task.

17.2 Manufacture and inspection plan

[RQ-071] Prior to commencement of the contract, the contractor shall draw up a manufacture and inspection plan clarifying the responsibilities with regard to testing of the material by Manufacturer, Purchaser of Material, ITER and any Third Party Inspector. The table below shows typical requirements for the testing plan.

[RQ-072]

Table 12.	Testing plan	(tentative)
-----------	--------------	-------------

M – Manufacturer	Test performance			
PoM – Purchaser of Material				
TPI – Third Party Inspector				
P – Performance and Evaluation of Tests Results	М	PoM	ITER	TPI
S – Supervision and Evaluation of Tests Results				

ITER_D_8G6DXM

1	Manufacturing program	Р	S	S	
2	Qualification test plan	Р	S	S	
3	Chemical analysis	Р		S	S
4	Mechanical test	Р	S	S	S
5	Optical test	Р	S	S	
6	Dimensional examination of each product according to the drawings. Actual dimensions shall be recorded	Р	S		S
7	Material identification	Р			
8	Marking control		Р		S
9	Check of final documentation		Р	S	
10	Certification of compliance	Р			S

[RQ-073] The manufacture and inspection plan shall identify the protection important activities. Note that a tentative list of PIA is given in [R13]

18 Development milestones and deliveries

[RQ-074] The development milestones and associated deliveries shall be specified by the customer in the purchase order.

19 Purchase order for pre-form material

[RQ-075] Purchase order for blank (pre-form) material shall:

- refer to a product special procurement specification
- include a technical appendix providing the following supplementary information
 - material ordered
 - quantity ordered
 - form of the product
 - nominal dimensions
 - the dimensions tolerances

20 Responsibilities

20.1 Contractor's Responsibilities

In order to successfully perform the tasks in this Technical Specification, the Contractor shall:

- Strictly implement the IO procedures, instructions and use templates;
- Provide experienced and trained resources to perform the tasks;
- Contractor's personnel shall possess the qualifications, professional competence and experience to carry out services in accordance with IO rules and procedures;

• Contractor's personnel shall be bound by the rules and regulations governing the IO ethics, safety and security IO rules.

20.2 IO's Responsibilities

The IO shall:

- Nominate the Responsible Officer to manage the Contract;
- Organise a monthly meeting(s) on work performed;
- Provide offices at IO premises.

21 List of Deliverables and due dates

D#	Description	T0 + x months
D1	 Work plan and organization IP#1 Verification Control Plan IP#2 Quality Plan IP#3 Detailed Scheduled 	T0 (Kick off meeting) + 1
D2	Manufacturing and inspection plan	2
D3	Delivery uncoated samples for material and optical characterization	5
D4	Delivery of samples for AR coating qualification	5
D5	Result Testing (mechanical, chemical and optic)	8
D6	FAT Protocol for disks	12
D7	Delivery disks to IO (Batch #01)	13
	Hold point specified in [RQ-005]	
D8	Delivery disks to IO (Batch #02)	36

22 Acceptance Criteria

The deliverables will be posted in the Contractor's dedicated folder in IDM, and the acceptance by the IO will be recorded by their approval by the designated IO TRO. These criteria shall be the basis of acceptance by IO following the successful completion of the services. These will be in the form of reports as indicated in section 21, Table of deliverables.

23 Work Monitoring / Meeting Schedule

Work is monitored through reports (see List of Deliverables, section 21) and at monthly project meetings for each of the projects.

24 Delivery time breakdown

See Section 8 "List Deliverables section and due dates".

25 Quality Assurance (QA) requirements

- [RQ-076] The Manufacturer shall comply with all requirements of ISO 9001 Certification. A quality assurance organization shall be implemented as required for fabrication in nuclear and ultra-high vacuum systems.
- [RQ-077] All procedures and specifications related to the materials procurement, qualification testing and acceptance testing shall be accepted by ITER before starting the manufacturing process.

[RQ-078] Particular attention shall to be paid to the traceability of all materials:

- Material origin; date of manufacturing
- Material manufacturing process identification
- Batch number of the pre-form
- Tests and inspections records
- Samples extracted from the blank shall be identified and kept after the tests
- Dates of inspections, instrumentation used for inspections, date of last calibration

[RQ-079] All data, which can have an impact on the reproducibility of the properties, shall be recorded and kept.

The general requirements are detailed in <u>ITER Procurement Quality Requirements</u> (ITER D 22MFG4).

Prior to commencement of the task, a Quality Plan must be submitted for IO approval giving evidence of the above and describing the organisation for this task; the skill of workers involved in the study; any anticipated sub-contractors; and giving details of who will be the independent checker of the activities (see <u>Procurement Requirements for Producing a Quality Plan (ITER_D_22MFMW)</u>).

Documentation developed as the result of this task shall be retained by the performer of the task or the DA organization for a minimum of 5 years and then may be discarded at the direction of the IO. The use of computer software to perform a safety basis task activity such as analysis and/or modelling, etc. shall be reviewed and approved by the IO prior to its use, in accordance with Software qualification policy (ITER_D_KTU8HH).

25.1 Access of inspectors

- [RQ-080] Representatives of the IO and of Third Party Inspectors (TPI) shall at reasonable notice have right to check at the Manufacturer premises the progress and status of the task and to witness the specified tests.
- [RQ-081] The Manufacturer shall hold and make available to the IO and TPI all necessary information and documentation to determine the progress and status of the task.

25.2 Testing Plan

[RQ-082] Prior to commencement of the contract, the contractor shall draw up a testing plan clarifying the responsibilities with regard to testing of the material by Manufacturer,

Purchaser of Material, ITER and any Third Party Inspector. The table below shows typical requirements for the testing plan.

M – Manufacturer Test performance					ce
PoM	PoM – Purchaser of Material M PoM ITER			TPI	
TPI -	– Third Party Inspector				
P – P	Performance and Evaluation of Tests Results				
S-S	Supervision and Evaluation of Tests Results				
1	Manufacturing programme	Р	S	S	
2	Qualification test plan	Р	S	S	
3	Chemical analysis	Р			
4	Mechanical test		S	S	S
5	Optical test		S	S	
6	Dimensional examination of each product according to the drawings. Actual dimensions shall be recorded	Р	S		S
7	Material identification				
8	Marking control		Р		S
9	Check of final documentation		Р	S	
10	Certification of compliance	Р			S

Table 13.	Testing plan	(tentative)
-----------	--------------	-------------

26 CAD Design Requirements (if applicable)

For the contracts where CAD design tasks are involved, the following shall apply:

The Supplier shall provide a Design Plan to be approved by the IO. Such plan shall identify all design activities and design deliverables to be provided by the Contractor as part of the contract.

The Supplier shall ensure that all designs, CAD data and drawings delivered to IO comply with the Procedure for the Usage of the ITER CAD Manual (<u>2F6FTX</u>), and with the Procedure for the Management of CAD Work & CAD Data (Models and Drawings <u>2DWU2M</u>).

The reference scheme is for the Supplier to work in a fully synchronous manner on the ITER CAD platform (see detailed information about synchronous collaboration in the ITER <u>GNJX6A</u> - Specification for CAD data production in ITER Contracts.). This implies the usage of the CAD software versions as indicated in CAD Manual 07 - CAD Fact Sheet (249WUL) and the connection to one of the ITER project CAD data-bases. Any deviation against this requirement shall be defined in a Design Collaboration Implementation Form (DCIF) prepared and approved by DO and included in the call-for-tender package. Any cost or labour resulting from a deviation or non-conformance of the Supplier with regards to the CAD collaboration requirement shall be incurred by the Supplier.

27 Safety requirements

ITER is a Nuclear Facility identified in France by the number-INB-174 ("Installation Nucléaire de Base").

For Protection Important Components and in particular Safety Important Class components (SIC), the French Nuclear Regulation must be observed, in application of the Article 14 of the ITER Agreement.

In such case the Suppliers and Subcontractors must be informed that:

- The Order 7th February 2012 applies to all the components important for the protection (PIC) and the activities important for the protection (PIA).
- The compliance with the INB-order must be demonstrated in the chain of external contractors.
- In application of article II.2.5.4 of the Order 7th February 2012, contracted activities for supervision purposes are also subject to a supervision done by the Nuclear Operator.

For the Protection Important Components, structures and systems of the nuclear facility, and Protection Important Activities the contractor shall ensure that a specific management system is implemented for his own activities and for the activities done by any Supplier and Subcontractor following the requirements of the Order 7th February 2012 (<u>PRELIMINARY ANALYSIS OF THE IMPACT OF THE INB ORDER - 7TH FEBRUARY 2012 (AW6JSB v1.0)</u>).

Compliance with <u>Defined requirements for PBS 55 - Diagnostics (NPEVB6 v2.0)</u> or its flowed down requirements in <u>SRD-55 (Diagnostics) from DOORS (28B39L v5.5)</u> is mandatory.


The safety requirements shall be propagated to the suppliers and subcontractors by following the following documents:


- Provisions for Implementation of the Generic Safety Requirements by the External Actors/Interveners (SBSTBM v2.2)
- Propagation of the Defined Requirements for Protection Important Components Through the Chain of External Interveners (BG2GYB v3.3)


This task is a PIA.


"The supplier must comply with the all requirements expressed in "Provisions for implementation of the generic safety requirements by the external actors/interveners" (SBSTBM)"


ANNEX I – Manufacturing drawings of the disks

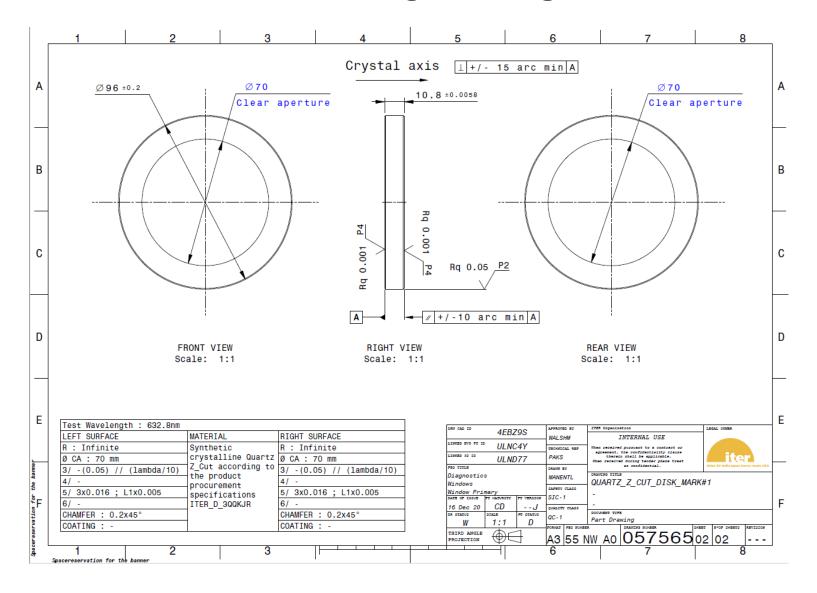

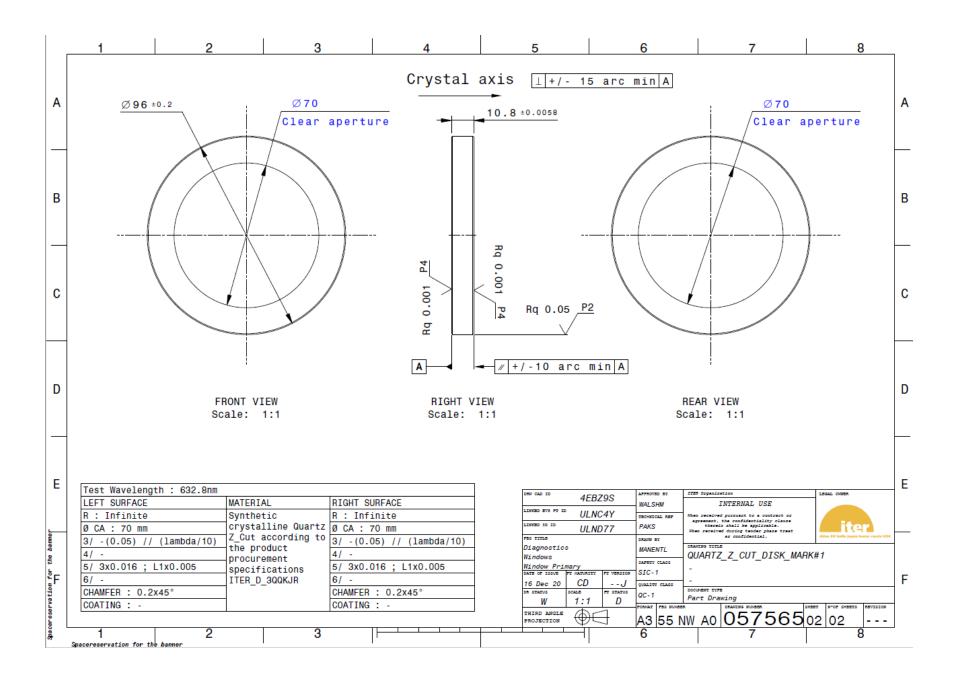

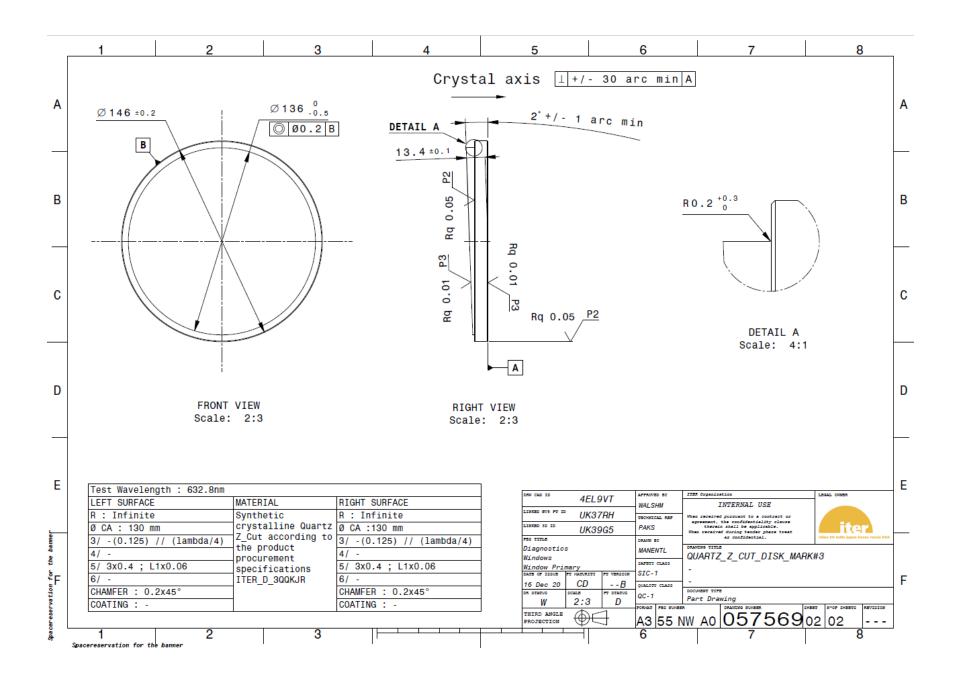

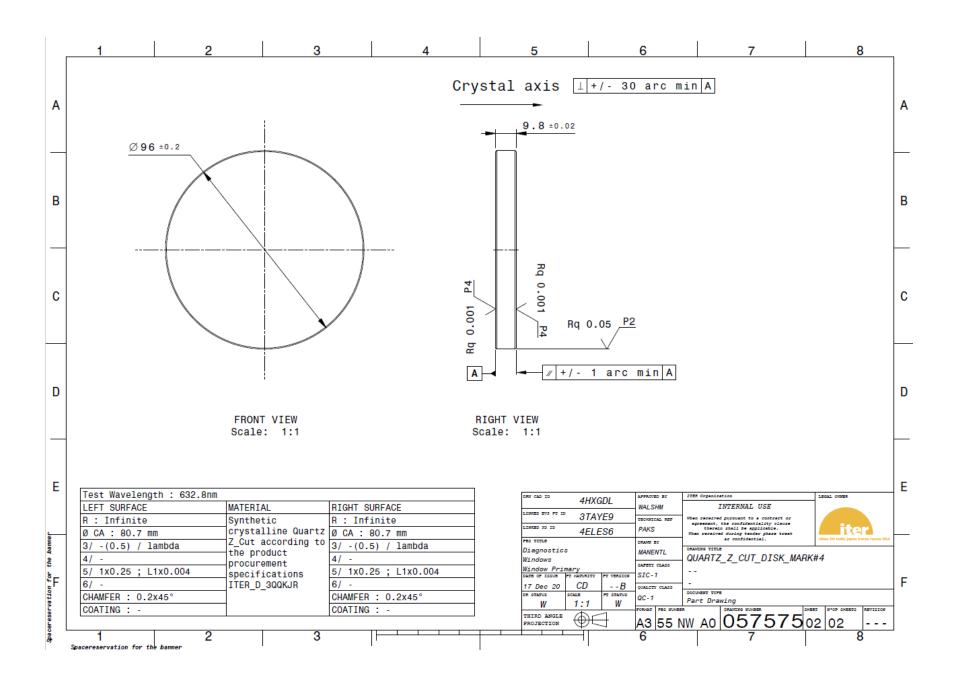

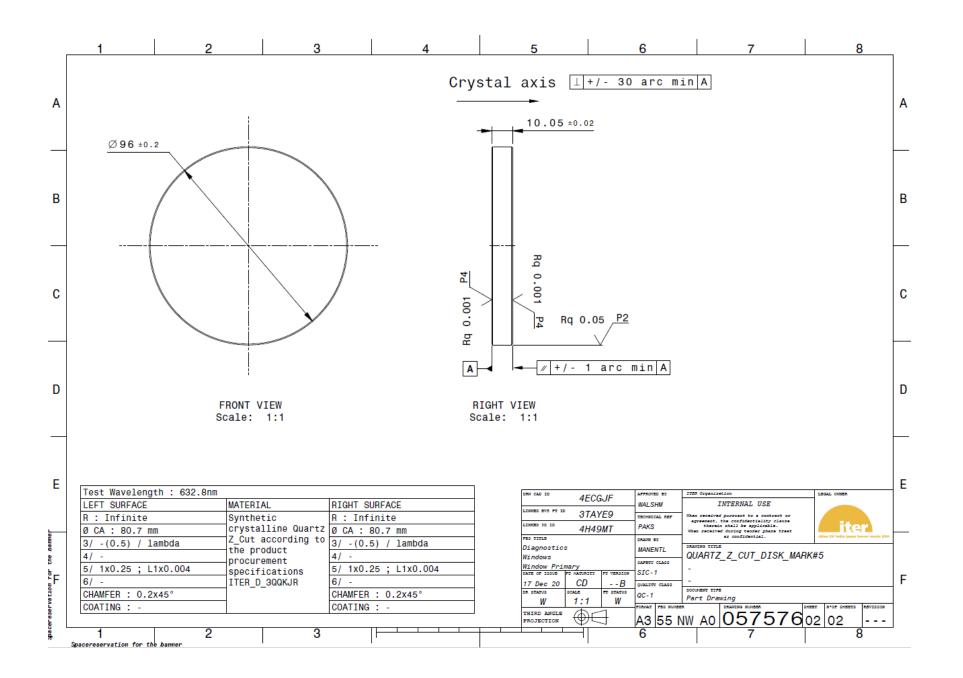

ANNEX II – Record of original requirements

For traceability purpose, the diagnostic requests are reminded in the table below.

Loc	Port	Diagnostic system	Disk variation	Mark	WA variation	Sub-variation	Disk Qty
Equatorial	10	C6 Poloidal polarimeter	Ø 82 CV - T = 10.8 mm	1	82_Qz_B_5Y_5Z_0		12
Upper	10	C6 Poloidal polarimeter	Ø 82 CV - T = 10.8 mm	1	82_Qz_B_5Y_5Z_0		6
Equatorial	11	E8 Neutral Particle Analyser	Ø 82 CV - T = 10.8 mm	1	82_Qz_B_5Y_5Z_0		8
Equatorial	12	EE Hard X-Ray monitor	Ø 82 CV - T = 10.8 mm	2	82_Qz_B_5Y_5Z_0	CS#1-Q	4
Equatorial	9	F1 Electron Cyclotron Emission	Ø 130 CV - T = 13.4 mm - Wedge 2°	3	130_Qz_5Y_5Z_2		4
Equatorial	11	F2 Low Field side reflectometry	Ø 82 CV - T = 9.8 mm	4	82_Qz_B_10Z10Z_0	CS #2-Q	6
Equatorial	11	F2 Low Field side reflectometry	Ø 82 CV - T = 10.05 mm	5	82_Qz_B_10Z10Z_0	CS#2-Q	6

Table 14: Diagnostic systems requests